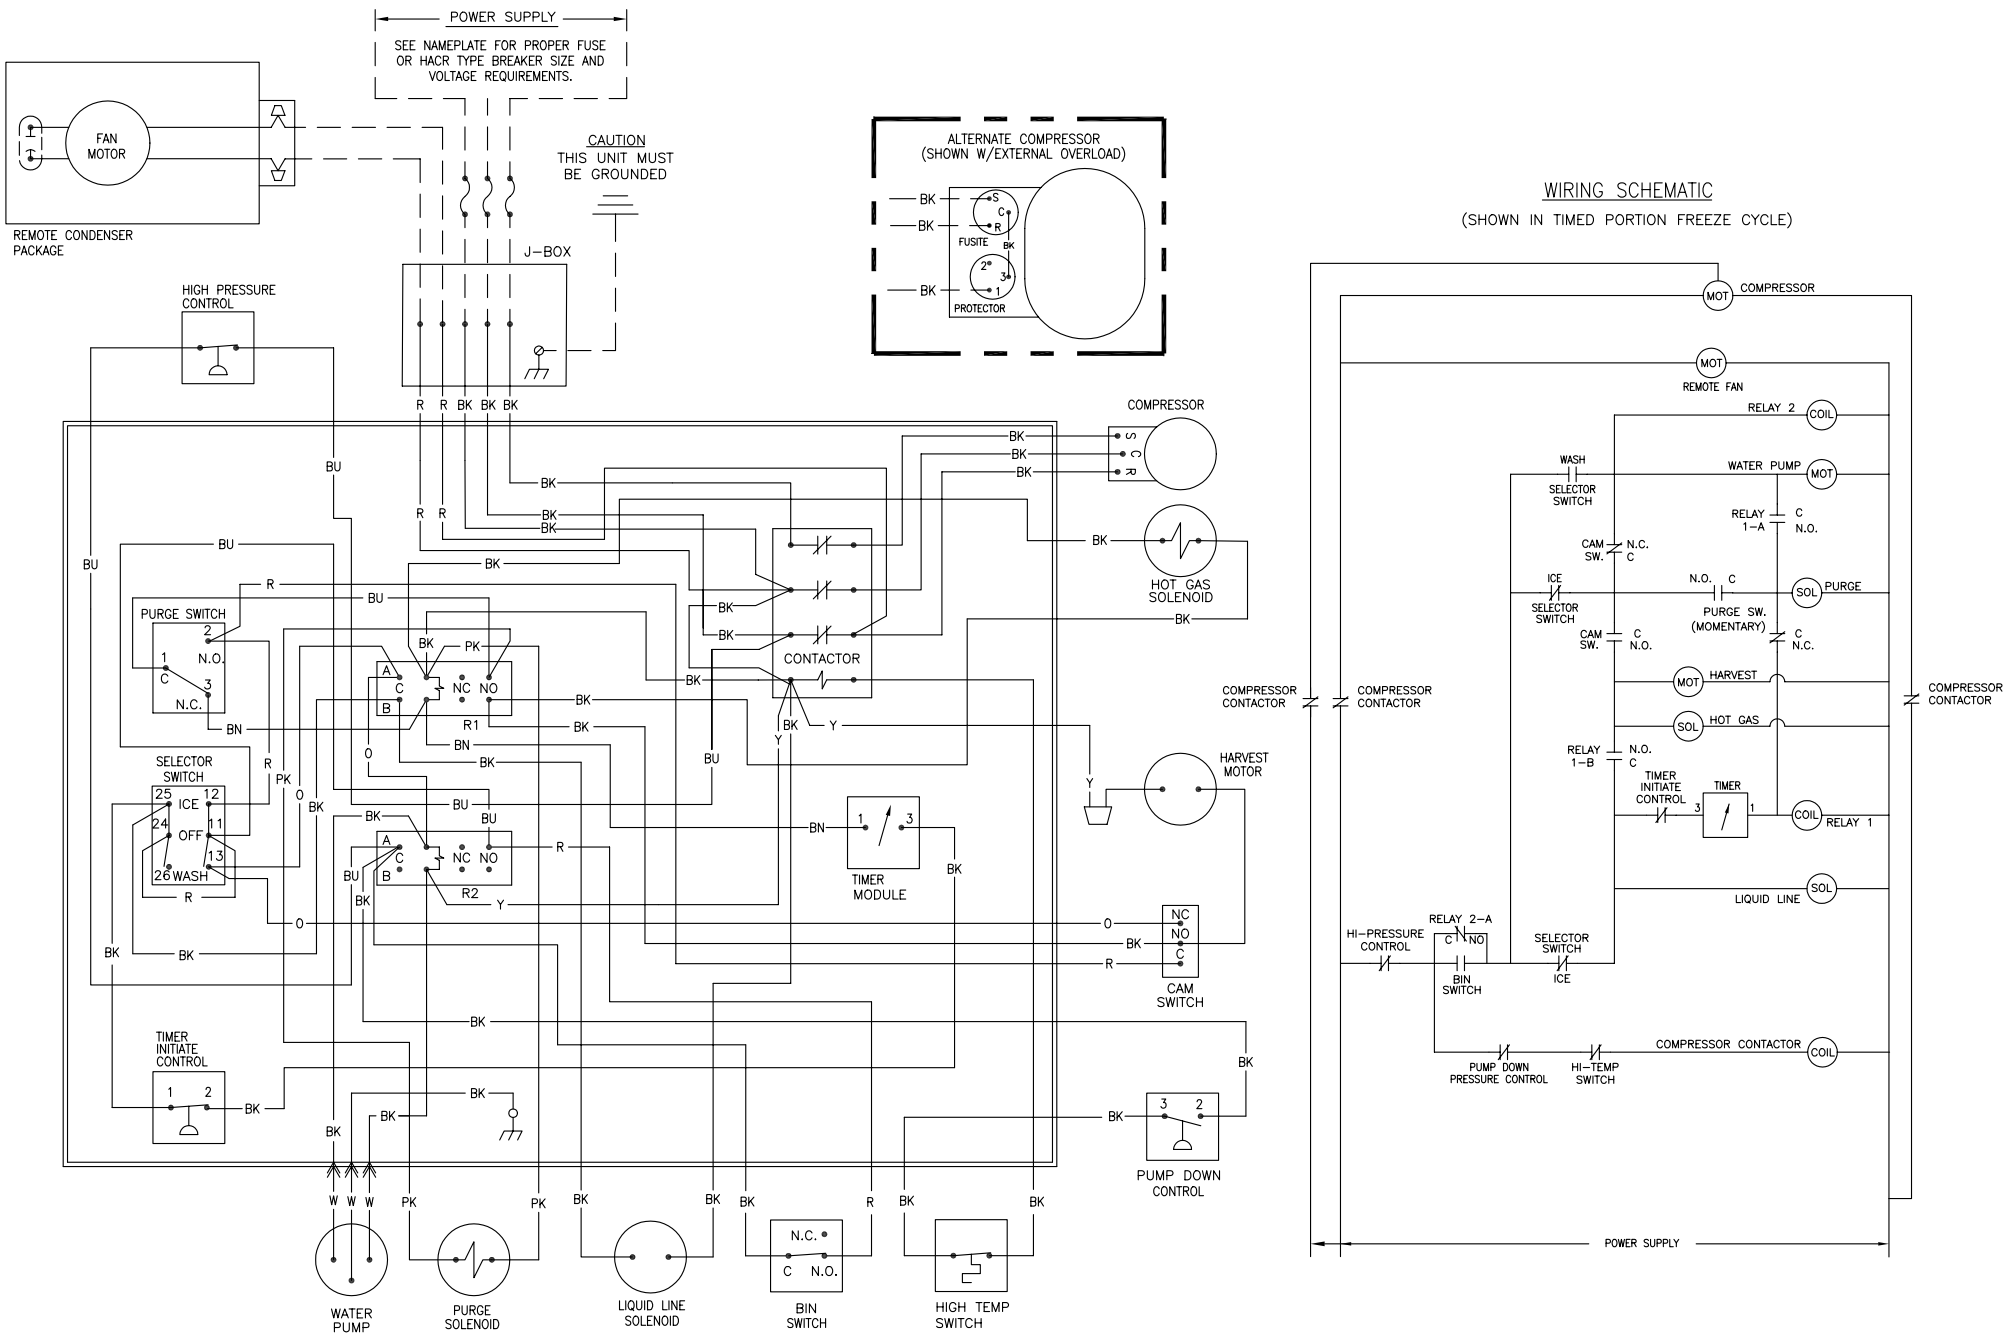
POWER SUPPLY
SEE NAMEPLATE FOR PROPER FUSE OR HACR TYPE BREAKER SIZE AND VOLTAGE REQUIREMENTS.
CAUTION
THIS UNIT MUST BE GROUNDED
FAN MOTOR
REMOTE CONDENSER PACKAGE
J-BOX
HIGH PRESSURE CONTROL
ALTERNATE COMPRESSOR
(SHOWN W/EXTERNAL OVERLOAD)
FUSITE
PROTECTOR
COMPRESSOR
HOT GAS SOLENOID
CONTACTOR
PURGE SWITCH
N.O.
N.C.
R1
R2
SELECTOR SWITCH
ICE
OFF
WASH
TIMER MODULE
HARVEST MOTOR
CAM SWITCH
TIMER INITIATE CONTROL
PUMP DOWN CONTROL
WATER PUMP
PURGE SOLENOID
LIQUID LINE SOLENOID
BIN SWITCH
HIGH TEMP SWITCH
WIRING SCHEMATIC
(SHOWN IN TIMED PORTION FREEZE CYCLE)
COMPRESSOR
REMOTE FAN
RELAY 2
WASH
SELECTOR SWITCH
WATER PUMP
RELAY 1-A
CAM SW.
ICE
PURGE
PURGE SW. (MOMENTARY)
HARVEST
HOT GAS
RELAY 1-B
TIMER INITIATE CONTROL
TIMER
RELAY 1
LIQUID LINE
HI-PRESSURE CONTROL
RELAY 2-A
BIN SWITCH
COMPRESSOR CONTACTOR
PUMP DOWN PRESSURE CONTROL
HI-TEMP SWITCH
POWER SUPPLY
9072070-01