


Service Bulletin

SUBJECT: Large Cuber Wiring

Number: 2026-04.16
Product: 48" CIM
Date Issued: 4/16/2026
From: Technical Service

48" wide CIM Model Ice Machines starting with March serial numbers (2603XXXXXXXXXX - 2604XXXXXXXXXX) must have the potential relay wiring inspected upon start-up. See Figure 1.

Figure 1: Incorrect Wiring

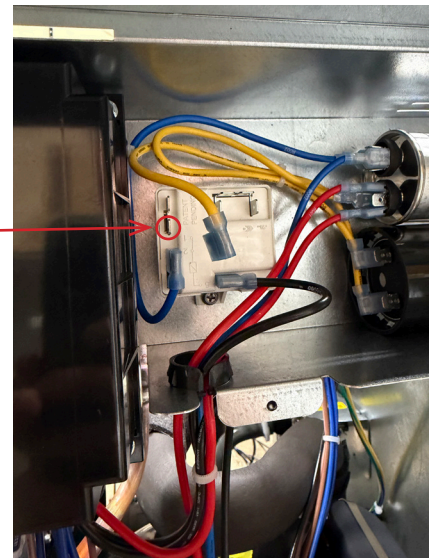

If this condition is found, reconnect the yellow wire coming from the 01 terminal on the start capacitor to the number 1 terminal on the Potential relay. See Figure 2

Figure 2: Correct Wiring

